uninsured United Parachute Technologies, LLC.









DATE: FEBRUARY 12, 2013 SERVICE BULLETIN #20121106 - REV 1 # OF PAGES: 2


COMPLIANCE DATE: February 12, 2013

SUBJECT: "Reserve Staging Loop" with support washer. We (manufacturer) require the washer be removed. At the next scheduled repack cycle, remove the washer from the bungee staging loop and tie a double over-hand knot as instructed below and reinstall.


STATUS: MANDATORY

BACKGROUND: During recent inspections prior to repacking the reserve, extra normal wear was found on the reserve closing loop. Further investigation indicates that Vector systems fitted with a (bungee) "Reserve Staging Loop" with support washer may experience this problem. Some washers have sharp edges which had caused minor damage to the closing loop. Thus far, loop damage seen in the field following a 365-day repack cycle has not been considered serious, but is a concern. This Product Service Notification provides a safe solution without altering the function of the staging loop.

SERVICE BULLETIN: At the next scheduled inspection/repack cycle remove the support washer from the "Reserve Staging Loop." (Fig-1) Inspect the internal and external condition of the staging loop and replace it if any damage is found. Tie a "Double Over-Hand Knot" at the prescribed location. The staging loop length should be 1-inch (25mm) shorter than the reserve closing loop. Mark the loop at the desired length. Fig-2 shows a single over-hand knot. Fig-3 shows the loop end passing one more time through to create the double

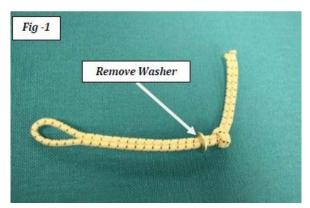



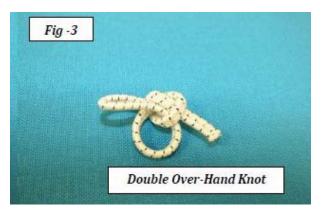



AUTHORITY:

Mark Procos, General Manager United Parachute Technologies LLC 1645 Lexington Avenue DeLand, FL 32724-2106 USA Telephone: +1 386 736 7589

FAX: +1 386 734 7537 Email: mark@uptvector.com

DISTRIBUTION:

- 1. All UPT Dealers
- 2. Parachute Industry Association Technical committee
- 3. Parachute Industry Association Rigging Committee
- 4. All Parachuting publications
- 5. Military Parachute Organizations
- 6. FAA MIDO
- 7. DGAC France

REVISIONS:

REV 1: Compliance date has been changed to February 12, 2013 Distribution list has been updated.