PRODUCT INFORMATION BULLETIN

Issue Date : **16th April 2026**

Bulletin Number : **PIB-01-2026**

Subject : **Vigil Cutter Service Life**

Background :

Multiple Vigil units have been returned to our Service Department, and during inspection, the units were found with a replacement cutter that had a DOM older than 6 months prior to the DOM of the Vigil unit. Use of a cutter that is older than 6 months prior to the DOM of the Vigil unit could possibly result in the cutter exceeding its Service Life

Compliance :

Vigil cutters placed on any Vigil unit should not be older than 6 months prior to the DOM of the Vigil unit.

New or used Vigil AADs with a cutter DOM older than 6 months prior to the DOM of the Vigil unit should not be installed in any parachute rig.

If the age of the cutter exceeds 6 months prior to the DOM of the Vigil unit, the complete Vigil unit should be sent back to the factory for servicing and cutter replacement. For Vigil 2+ AADs, the cutter can be replaced in the field.

The expected Service Life of a Vigil cutter is 20 years + 6 months.

Identification :

Vigil Cutter DOM MM/YY

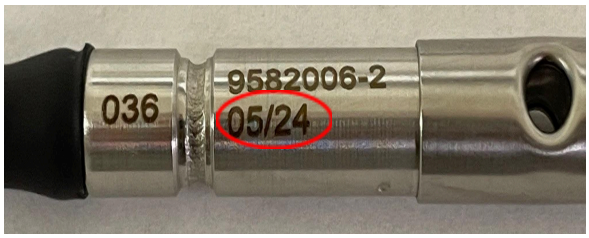

AAD nv/sa. Advanced Aerospace Designs - Belgium
220 Luikersteenweg, 3700, Tongeren, Belgium | Phone: +32 12 210 250 | info@vigil.aero | www.vigil.aero

Authority:

Sven Ibens
Managing Director

AAD nv/sa - Advanced Aerospace Designs
220 Luikersteenweg, 3700, Tongeren, Belgium
+32 12 210 250
info@vigil.aero

Vigil America, Inc
1400 Flightline Blvd suite "C"
Deland, FL 32724 - USA
+1 386-736-8464
info@vigilamerica.com

www.vigil.aero